

Handy Calibrators

CA51/CA71

- Generating and measuring operations can be performed at the same time.
 (Select from the following generated signal and measurement signal options: voltage, current, resistance, thermocouple (TC), resistance temperature detector (RTD), frequency, pulse).
- AC voltages, including supply voltage, can be measured.
- Includes a wide array of additional functions.
- Easy operation.
- Compact size and Lightweight



Actual Size

CA51/CA71

Handy Calibrators

Comprehensive generating/measuring instruments for all your calibration and equipment checking needs at maintenance sites

Sensors and instruments require a wide variety of operation checks in the field. The CA71 Handy Calibrator is a small, lightweight, multifunction calibrator that can simultaneously generate and measure voltage, current, resistance, TC, RTD, frequency, and pulse signals. The CA51 Handy Calibrator is a basic model with the same functions as the CA71 except TC and RTD measurement functions and online communication functions.

Simultaneous signal generation and measurement capability

The CA71 lets you handle regular tests on TCs, RTDs and various other types of sensors and instruments, as well as operation checks when a problem has occurred. By itself it can generate signals for input to equipment, and check output signal from equipment. With the CA71, you don't need to worry about synchronizing operations with other setting devices. (TC and RTD measurement functions are CA71 only.)



A wide array of useful functions

Generation

Values set in steps of 4–20 mA 24V DC Power Supply to Transmitter

• Divided output (n/m) function

Output settings are divided, eliminating the need for bothersome calculations for percentage output.

Autostep function

Changes the output value in step form based on the setting from the divided output (n/m) function. Changes can be generated automatically every 10% or 25%.

Online communication (CA71 only)

RS-232C-compliant optically isolated interface

Sweep function

Linearly increases or decrease the output. The increasing/decreasing time can be set to either 16 or 32 seconds.

Memory function

Generated values and measurements forming individual value sets can be saved to or read from the Handy Calibrator's internal memory (maximum 50 value sets).

• Temperature monitor function

AC voltage (including supply voltage) measurement capability

In cases where numerous signal converters and other devices are mounted on a rack or panel, the Handy Calibrator can be used to check the input and output signals of each device, while simultaneously checking the power supply. There is no need for a separate multimeter to measure supply voltage.




Easy operation

The Handy Calibrator incorporates rotary switches for simple handling. Just open the carrying case cover and connect the cables, and you're ready to take measurements.



Panel layout

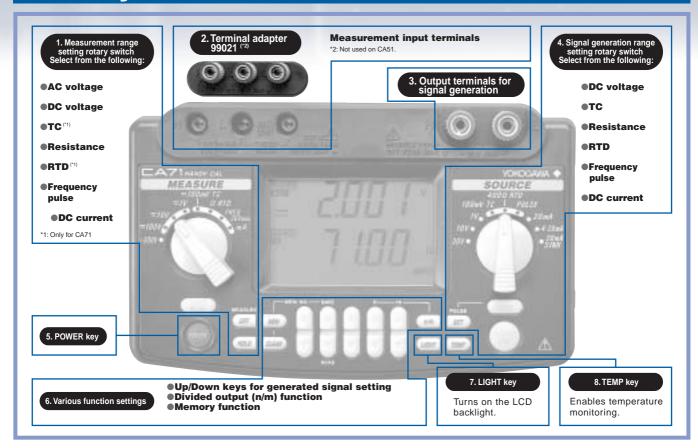

Spare parts

Product	Signal generating lead cable	Measurement lead cable	Carrying case	Terminal adapter	Fuse
		0			
Model	98020	RD031	93016	99021	A1501EF
Remarks	One set, including one red cable and two black cables. Length: approximately 1.7 meters	One set, including one red cable and one black cable. Length: approximately 1.0 meter	The carrying case can hold the signal generating and measurement lead cables, terminal adapter, four spare batteries, fuses, AC adapter, and user's manual.	Used in temperature measurement (for CA71).	For current terminal input protection. (10pcs/set)

Optional accessories (sold separately)

Product	AC adapter	RJ sensor	Accessory carrying case	Communication cable (R\$232)
Model	A1020UP, A1022UP, B9108WB	B9108WA	B9108XA	91017
Remarks	A1020UP: 100 V AC power supply adapter A1022UP: 120 V AC power supply adapter B9108WB: 220–240 V AC power supply adapter	For reference junction compensation	Can hold lead cables, RJ sensor, etc.	D-sub 9-pin (female)

Handy Calibrator main unit					
Product	CA71 Handy Calibrator	CA51 Handy Calibrator			
	•	* · ·			
Model	CA71 CA51				
Standard accessories	All of the following are included: Signal generating lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter for CA71: 99021 User's manual: IM CA71-E Fuse: A1501EF (for current terminal input protection) Four AA alkaline batteries: A1070EB ×4				

Related product

Thelated product		
Product	Handy Calibrators CA11/12/13	
Model	71010/21/30	
Remarks	CA11: Voltage/current model CA12: Temperature model CA13: Frequency model	

□△51 and □△71 Specifications

Signal generating unit range and accuracy (for both CA51 and CA71)

ject less		
less		
TC generating accuracy does not include R. sensor accuracy. RJ sensor specs		
Measurement range: -10–50°C Accuracy (when combined with main unit) 18–28°C: ±0.5°C Other than the above: ±1°C		
waveform		
ch		
1		

imperature coefficient: Accuracy shown above $\times (1/5)^n\mathbb{C}$. Cuburu tip to 24 V/22 mA is possible when using the AC adapter.

Cuburu tip to 24 V/22 mA is possible when using the AC adapter.

As per JIS C 1604-1997 (ITS-90), IPTS-68 may be selected through internal settings (DIP switch).

Excitation current: If less than 0.1 mA to 0.5 mA, then add $(0.025/\text{s} \text{ (mA)}] \Omega \text{ or } [0.06/\text{s} \text{ (mA)}]^n\mathbb{C}$.

As per JIS C 1602-1995 (ITS-90) (L and U are DIN specs).

Ex E, L, T, N, R, S, and B may be switched to IPTS-68 through internal settings (DIP switch) (L and U are not switched).

Expequency (interval between one pulse and another) and amplitude during pulse cycle generation may have the same range as expensed an approximation.

General specifications (for both CA51 and CA71)

Parameter	Specification		
Signal generating unit response time	Approximately 1 second (time between start of voltage change and when voltage enters accuracy range)		
Signal generating unit voltage limiter	Approximately 32 V		
Signal generating unit current limiter	Approximately 25 mA		
Divided output (n/m) function	Output = setting \times (n/m) n = 0-m; m = 1-19; n \leq m		
Auto-step output function	n value sent automatically when n/m function selection is selected (two options: approximately 2.5 seconds/step or approximately 5 seconds/step)		
Sweep function	Sweep time (two options: approximately 16 seconds or approximately 32 seconds)		
Memory function	50 value sets (generated and measured values are stored as value sets with the same address (up to 50 value sets can be stored))		
Measuring unit maximum input	Voltage terminal: 300 V AC Current terminal: 120 mA DC		
Current terminal input protection	Fuses: 125 mA/250 V		
Measuring unit ground voltage	Maximum 300 V AC		
Measurement display updating rate	Approximately once per second		
Serial interface	Enabled when communication cable (RS232) is connected; sold separately as optional accessory (CA71 only)		
Display	Segmented LCD (approximately 76 mm × 48 mm)		
Backlight	LED backlight; auto-off after one minute (from when LIGHT key is turned on)		
Power supply	Four AA alkaline batteries, or special AC adapter (sold separately)		
Battery life	Measurement off, output S V DC/10 kΩ or greater: Approximately 40 hours Simultaneous signal generation/measurement, output 5 V DC/10 kΩ or greater: Approximately 20 hours Simultaneous signal generation/measurement, output 20 mA/5 V: Approximately 12 hours (using alkaline batteries, with backlight off)		
Consumed power	Approximately 7 VA (using 100 V AC adapter)		
Auto-power-off function	Approximately 10 minutes (auto-power-off can be disabled through a DIP switch setting)		
Applicable standards	IEC61010-1, IEC61010-2-31 EN61326-1: 1997 + A1: 1998 EN55011: 1998, Class B, Group 1		
Insulation resistance	Across input terminal and output terminal, 500 V DC, 50 MΩ or greater		

Measurement unit range and accuracy (for both CA51 and CA71) Accuracy: ±(reading percentage plus μV, mV, μA, Ω or dgt (digit))

Parameter	Reference	Range	Accuracy (23±5°C per year)	Resolution	Ren	narks
	100 mV	0-±110.00 mV	±(0.025% + 20 μV)	10 μV	Input resistance: 10 $\text{M}\Omega$ or greater	
DC voltage	1 V	0-±1.1000 V	±(0.025% + 0.2 mV)	0.1 mV		
DC voltage	10 V	0-±11.000 V	±(0.025% + 2 mV)	1 mV	Innut registance: A	pprovimetoly 1 MO
	100 V	0-±110.00 V	±(0.05% + 20 mV)	0.01 V	Input resistance: Approximately 1 MΩ	
DC current	20 mA	0-±24.000 mA	±(0.025% + 4 μA)	1 μΑ	Input resistance: Approximately 14 Ω	
DC current	100 mA	0-±100.00 mA	±(0.04% + 30 μA)	10 μΑ		
Resistance	400 Ω	0–400.00 Ω	±(0.05% + 0.1 Ω)	0.01 Ω	Accuracy during 3-wire measurement	
	1 V	0-1.100 V	±(0.5% + 5 dgt)	1 mV	Approximately 10 45–65 Hz MΩ/10 pF Input volta	Input frequency:
۸۵	10 V	0-11.00 V		0.01 V		Input voltage range:
AC voltage	100 V	0-110.0 V		0.1 V	Input resistance: Approximately 1	10%-100% Measurement
	300 V	0-300 V	±(0.5% + 2 dgt)	1 V	MΩ/10 pF	method: Average value rectification
	100 Hz	1.00-100.00 Hz		0.01 Hz	Maximum input: 30 V peak	
	1000 Hz	1.0-1000.0 Hz		0.1 Hz	Input resistance: 200 kΩ or greater Sensitivity: 0.5 V peak or greater	00 kΩ or greater
Frequency, pulse	10 kHz	0.001-11.000 kHz	±2 dgt	0.001 kHz		
F	CPM	0-99,999 CPM		1 CPM		minute
	CPH	0-99,999 CPH		1 CPH	CPH: Counts per hour	

Measurement unit (temperature; CA71 only) range and accuracy

Accuracy: ±(reading percentage + °C)

		11	200.0 1072.0 0	±(0.05% + 1.5°C) (-100°C or greater) ±(0.05% + 2°C) (-100°C or less)		
		E	-200.0-1000.0°C		0.1°C	
		J	-200.0-1200.0°C			1
		Т	-200.0-400.0°C			
TC *	*7	N	-200.0-1300.0°C			
10		L	-200.0–900.0°C			
		U	-200.0-400.0°C			
		R	0-1768°C	±(0.05% + 2°C) (100°C or greater) ±(0.05% + 3°C) (100°C or less)	1°C	
	RTD	S	0-1768°C			
		В	600-1800°C			
DTD		Pt100 *6	-200.0-850.0°C	±(0.05% + 0.6°C)	0.1°C	Accuracy during 3-wire measurement
KIL		JPt100	-200.0–500.0°C	1 ±(0.03 % + 0.0 C)		

Temperature Coefficient. Accuracy strown source x (199) = (8. Apr pril SC 1904)-1971 (ST89) (PTS-68 mp.) be selected through internal settings (DIP switch).

7- As per IJS C 1602-198 (TIS-99) (I and U are DIN specs).

K, E, J, T, N, R, S, and B mg) be writched to PTS-68 through internal settings (DIP switch) (L and U are not switched).

Parameter		Specification		
	Withstand voltage	Across input terminal and output terminal, 3.7 kVAC, for one minute		
	Operating temperature and humidity ranges	0-50°C, 20-80% RH (no condensation)		
	Storage temperature and humidity ranges	-20-50°C, 90% RH or less (no condensation)		
	External dimensions (WHD)	Approximately 190 × 120 × 55 mm		
	Weight	Approximately 730 g (including batteries)		
	Standard accessories	All of the following are included: Signal generating lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter for CA71: 99021 User's manual: IM CA71-E Fuse: A1501EF (for current terminal input protection) Four AA alkaline batteries: A1070EB × 4		
	Optional accessories (sold separately)	AC adapter: A1020UP (100 V AC power supply) AC adapter: A1022UP (120 V AC power supply) AC adapter: B9108WB (220–240 V AC power supply) RJ sensor: B9108WA (For reference junction compensation) Accessory carrying case: B9108XA Communication cable: 91017		
	Spare parts	Signal generating lead cables (one red, two black): 98020 Measurement lead cables (one red, one black): RD031 Carrying case: 93016 Terminal adapter: 99021 Fuse: A1501EF (for current terminal input protection)		

YOKOGAWA Yokogawa M&C Corporation

World Wide Web site at http://www.yokogawa.com/MCC

⚠NOTICE

 Before using the product, read the instruction manual carefully to ensure proper and safe operation.

YOKOGAWA M&C CORPORATION International Sales Dept.

Musashino Center Bldg.

1-19-18 Nakacho, Musashino-shi, Tokyo, 180-0006 Japan Phone: +81-422-55-8755 Facsimile: +81-422-55-8954

YOKOGAWA CORPORATION OF AMERICA (U.S.A.) YOKOGAWA EUROPE B. V. (THE NETHERICA (U.S.A.)
YOKOGAWA EUROPE B. V. (THE NETHERLANDS)
YOKOGAWA ENGINEERING ASIA PTE. LTD. (SINGAPORE)
YOKOGAWA AMERICA DO SUL LTDA (BRAZIL)
YOKOGAWA MEASURING INSTRUMENTS KOREA CORPORATION (KOREA)
YOKOGAWA AUSTRALIA PTY. LTD. (AUSTRALIA) YOKOGAWA BLUE STAR LTD. (NDIA)
YOKOGAWA MIDDLE EAST E.C. (BAHRAIN)
LTD. YOKOGAWA ELECTRIC (RUSSIAN FEDERATION)

Phone: +1-770-253-7000 Phone: +31-334-64-1611 Phone: +65-241-9933 Phone: +55-15-681-2400 Phone: +58-1-7-0660 to 0664 Phone: +61-2-9805-0699

Phone: +91-80-227-1513 Phone: +973-358100 Phone: +7-095-737-7868

Facsimile: +1-770-251-2086 Facsimile: +31-334-64-1610 Facsimile: +65-241-2606 Facsimile: +55-11-5681-1274/4434 Facsimile: +82-2-551-0665 Facsimile: +61-2-9888-1844 Facsimile: +91-80-227-4270 Facsimile: +973-336100 Facsimile: +7-095-737-7869

Facsimile: +1-770-251-2088

Represented by:

MCK-ES9